

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

**CHILD SEATS:**

Orbit Baby, Inc. (Orbit) is recalling certain G2 Car Seat Bases, Model No. ORB822000, manufactured from March 20, 2013, through July 20, 2013, with batch numbers A0840, A0860, or A0880. The StrongArm Knob component of the Orbit Baby G2 Car Seat Base intended to secure the seat's base, may become detached or spin. If the seat base is not properly secured, a child may be at an increased risk of injury in the event of a crash. Registered owners will be notified and Orbit will provide a free remedy kit along with repair instructions to them or any owner that notifies Orbit of the need for a kit. The recall began on November 22, 2013. Owners may contact Orbit Baby Customer Service at 1-877-672-2229.

**13C-003**

**EQUIPMENT:**

Meritor, Inc. is recalling certain wheel ends for drive axles with ConMet PreSet Plus Hubs between August 2012 and December 2012. Due to a missing locking snap ring on the axle hub, the rear wheels may separate from the vehicle. Wheel separation from the vehicle increases the risk of a crash. Meritor will notify owners and dealers will inspect the affected wheel ends for the lock ring, installing them as needed, free of charge. The safety recall began on October 23, 2013. Owners may contact Meritor at 1-866-668-7221.

**13E-054**

ILJIN USA Corporation (ILJIN) is recalling certain SKF USA and Federal Mogul (MOOG)-brand front wheel bearings with an integrated wheel speed sensor produced from June 26, 2013 to September 27, 2013. The affected bearings were produced with the speed sensor wires reversed. Due to the reversed wires, the wheel speed sensor will not function, disabling the antilock brake system (ABS). Without ABS, the driver may have reduced control of the vehicle while braking and require a longer distance to stop the vehicle, increasing the risk of a crash. ILJIN will notify purchasers and will replace the wheel sensor wiring harness, free of charge. ILJIN will fully reimburse any purchasers or end users who have already removed, repaired or replaced the defective part or paid someone to do so. The recall began on December 9, 2013. Owners should contact ILJIN at 1-248-848-1020 to obtain details about the reimbursement program.

**13E-055**

Wheel Pros, LLC is recalling certain Moto Metal-brand 8-Lug bolt pattern wheels, model MO909. The affected wheels are susceptible to cracking. A cracked wheel may lead to separation of the tire from the rim, potentially resulting in a loss of vehicle control thereby increasing the risk of a crash. Wheel Pros, LLC will work with its distributor/retailer customers to notify customers and replace the wheels, free of charge. The recall is expected to by early December 2013. Owners may contact Wheel Pros at 1-303-433-3599.

**13E-056**

Keyline Sales is recalling certain exterior doors manufactured January 1, 2006, through April 25, 2013 for use in cargo and specialty trailers that were built with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the trailer at the time will then be locked in and be unable to exit the vehicle, increasing the risk of injury. Keyline Sales will notify the manufacturers that purchased the affected doors from them, and Fastec will coordinate the inspection and replacement of the lock cylinders, as needed, free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

The recall began on November 19, 2013. Owners may contact Keyline Sales at 1-574-294-5611 or Fastec at 1-800-837-2505.

**13E-057**

**TIRES:**

Hankook Tire America Corp. (Hankook) is recalling certain Dynapro MT LT325/60R18 RT03 tires manufactured August 21, 2011, through September 28, 2013. The affected tires may develop a separation at the tread/belt edge. Tread separation can result in tire failure and loss of vehicle control, increasing the risk of a crash. Hankook will notify owners and dealers will replace the tires, free of charge. The recall began on November 22, 2013. Owners may contact Hankook at 1-800-426-5665.

**13T-008**

Yokohama Tire Corporation (Yokohama) is recalling certain 7.50R16 RY215 tires manufactured January 1, 2006, through August 1, 2011. These tires are missing the "DOT" prefix, the required load/inflation information and do not list the material and number of structural plies. Thus, these tires fail to comply with the requirements of Federal Motor Vehicle Safety Standard, No. 119, "New Pneumatic Tires for Motor Vehicles with a GVWR of more than 4,536 kilograms (10,000 pounds) and Motorcycles." Without load/inflation markings, owners may overload the tire which could result in tire failure, increasing the risk of a crash. Yokohama will notify owners and dealers will replace the tires, free of charge. The recall is expected to begin by late November 2013. Owners may contact Yokohama at 1-800-423-4544.

**13T-009**

**VEHICLES:**

Toyota is recalling certain model year 2012-2013 Avalon, Avalon HV, Venza, Camry, and Camry HV vehicles. In the affected vehicles, the drain hose for the air conditioning condenser may become clogged causing water to accumulate at the bottom of the air conditioning condenser unit housing. The accumulated water may then leak through a seam in the housing onto the air bag control module potentially resulting in a short circuit of the module. A short circuit may cause the air bags to become disabled or inadvertently deploy. An inadvertent airbag deployment can increase the risk of injury or the possibility of a crash. An inoperative airbag can increase the risk of injury in a severe crash. The power steering assist could also become inoperable resulting in increased steering effort and can increase the risk of a crash at low speeds. Toyota will notify owners, and dealers will seal the air conditioning condenser unit housing and install a protective cover on the airbag control module, free of charge. The recall is expected to begin during December 2013. Owners may contact Toyota at 1-800-331-4331.

**13V-442**

Nissan is recalling certain model year 2013-2014 Nissan Pathfinder vehicles manufactured April 18, 2012, through September 20, 2013; model year 2013 Infiniti JX35 vehicles manufactured September 15, 2011, through January 16, 2013; and model year 2014 Infiniti QX60 vehicles manufactured January 17, 2013, through

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES**

**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

September 20, 2013. In the affected vehicles, during light braking on rough roads, the antilock brake system (ABS) brake pressure output software may lead to an increase in stopping distance. The increased stopping distance may increase the risk of a crash. Nissan will notify owners, and dealers will reprogram the ABS, free of charge. The recall began on November 18, 2013. Owners may contact Nissan at 1-800-647-7261.

**13V-445**

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2004-2013 GSX-R600 and GSX-R750, and model year 2005-2013 GSX-R1000 motorcycles. In combination with older brake fluid, corrosion of the brake piston inside of the front brake master cylinder generates gas that may result in a reduction of fluid pressure transmission to the front brake. As a result, front braking power may be reduced increasing the risk of a crash. Suzuki will notify owners, and dealers will replace the front brake master cylinder, free of charge. The recall began on November 18, 2013. Owners may contact Suzuki at 1-800-572-1490. Suzuki's campaign numbers for this recall are: 2A (31, 32, 33, 34, 35, and 36).

**13V-449**

Ford Motor Company (Ford) is recalling certain model year 2012-2013 Focus Electric vehicles and 2013 C-Max vehicles equipped with the Intelligent Access Push Button Start System. In the affected vehicles, there is no audible chime when the vehicle is operational and the driver's door is opened. Thus, these vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) No. 114, "Theft Protection and Rollaway Prevention." Without an audible door chime, a vehicle owner may open the door and exit the vehicle without being reminded that the vehicle is still operational, leaving the vehicle susceptible to theft. Ford will notify owners, and dealers will update the software for the door chime, free of charge. The recall began on October 30, 2013. Owners may contact the Ford customer relationship center at 1-866-436-7332. Ford's recall number is 13C07.

**13V-475**

Shadow Trailers Inc. (Shadow Trailers) is recalling certain model year 2006-2012 gooseneck and bumperpull horse trailers manufactured December 1, 2005, through August 11, 2011 and equipped with Fastec-brand door locks with key cylinder numbers HF 304, HF 307, HF 308 and HF 309. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Shadow Trailers will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall began during September 2013. Owners may contact Shadow Trailers at 1-352-529-2190 or Fastec at 1-800-837-2505.

**13V-479**

Blue Bird Body Company (Blue Bird) is recalling certain model year 2004 Ultra LMB, 2003-2006 Ultra LF and 2004-2007 Express commercial buses equipped with Sure Power-brand battery equalizers containing a particular epoxy sealing, aka 'potting', compound. The specific potting compound used in the subject products for insulation was found to be capable of conducting electricity after being exposed to heat. Once electrically conductive, the material is capable of melting and burning, increasing the risk of a fire. Blue Bird will notify owners, and dealers will replace the equalizers, free of charge. The recall is expected to begin during December

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES**

**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

2013. Owners may contact Blue Bird at 1-478-825-2021. Blue Bird's recall number is R13WN.

**13V-480**

Vintage Trailers Ltd. (Vintage Trailers) is recalling certain model year 2007-2013 Crystal, Intimidator, Aero, Outlaw, Bandit, and Cargo trailers manufactured January 2007 through May 2013 and equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Vintage Trailers will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall began on December 13, 2013. Owners may contact Vintage at 1-800-233-5455 or Fastec at 1-800-837-2505.

**13V-482**

Chrysler Group, LLC (Chrysler) is recalling certain model year 2014 Jeep Grand Cherokee vehicles manufactured January 8, 2013, through August 20, 2013. Due to a disruption of computer communications and loose alternator ground wires, the affected vehicles may experience random illumination of multiple instrument cluster warning lights, loss of cluster illumination and loss of anti-lock brake system (ABS) and electronic stability control (ESC) function. Because of these conditions, the vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 101, "Controls and Displays," and No. 126, "Electronic Stability Control Systems." A loss of ABS and ESC function reduces the driver's ability to control the vehicle. Drivers would not be warned of brake system failures or any other failures which would be illuminated on the dashboard display. Either condition increases the risk of a crash. Chrysler will notify owners, and dealers will update the ABS and instrument cluster module software and tighten the alternator ground wire, free of charge. The recall began on November 19, 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N58.

**13V-483**

Bentley Motors, Inc. (Bentley) is recalling certain model year 2007 through 2011 Continental GT, GTC, and Flying Spur vehicles, manufactured from July 2006 through June 2010 and equipped with carbon ceramic brake discs. In the affected vehicles, the stainless steel screws that secure the brake rotors may fail after being exposed to salty conditions. Failure of the securing screws may result in a reduction of braking ability, increasing the risk of a crash. Bentley will notify owners, and dealers will replace the screws, free of charge. The safety recall began on October 22, 2013. Owners may contact Bentley at 1-800-777-6923. Bentley's number for this campaign is RE13/14.

**13V-484**

Chrysler Group LLC (Chrysler) is recalling certain model year 2014 RAM 1500, 2500, and 3500 trucks manufactured July 1, 2013, through August 22, 2013. Randomly, the warning lights in the instrument cluster may fail to illuminate as designed. Inoperative warning lights may not properly warn the driver of vehicle problems, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the instrument cluster software, free of charge. The recall began on November 25, 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N59.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

**13V-486**

New Flyer Industries Ltd. (New Flyer) is recalling certain model year 2013 XD40 buses manufactured May 24, 2013, through September 5, 2013; model year 2013 XN40 buses manufactured April 18, 2013, through September 11, 2013; model year 2013 XD60 buses manufactured May 31, 2013, through September 5, 2013; and model year 2013 XDE40 buses manufactured on May 17, 2013. The color coded air lines to the E-6 brake treadle valve may have been installed incorrectly. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 121, "Air Brake Systems." In the event of a loss of air supply pressure in the rear air reservoir, there would be a loss of service braking effect on both the front and rear axles, increasing the risk of a crash. New Flyer has notified owners, and dealers will inspect, and correct the air line routing, as needed, free of charge. Owners may contact New Flyer at 1-204-982-8400. New Flyer's recall number is R13-023.

**13V-487**

General Motors (GM) is recalling certain model year 2014 Chevrolet Silverado and GMC Sierra 1500 vehicles manufactured August 1, 2013, through September 10, 2013, and equipped with manual reclining seatbacks. In the affected vehicles, either of the front seatbacks may have play. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 202a, "Head Restraints." If the vehicle is struck from behind, the head restraint may not properly protect occupants, increasing the risk of injury. GM has notified owners. Dealers will inspect the seatback recliner mechanisms and make adjustments, as needed, free of charge. The recall began on October 23, 2013. Owners may contact Chevrolet at 1-800-222-1020 and GMC at 1-800-462-8782. GM's recall number is 13323.

**13V-488**

Hyundai is recalling certain model year 2009-2012 Genesis vehicles manufactured April 30, 2008, through March 28, 2012. The vehicles may contain brake fluid which does not protect against corrosion of the Hydraulic Electronic Control Unit (HECU). If the module corrodes, reduced brake effectiveness may result, increasing the risk of a crash. Hyundai will notify owners and instruct them to bring their vehicle to a dealer for service. Hyundai will inspect the HECU module for proper operation, and will replace the modules as necessary. Hyundai will replace the factory brake fluid in those vehicles that have not previously had the factory brake fluid replaced. These repairs will be done free of charge. The recall is expected to begin by the end of December 2013. Owners may contact Hyundai at 1-800-633-5151 or by email at [consumeraffairs@hmmausa.com](mailto:consumeraffairs@hmmausa.com). Hyundai's recall number is 114.

**13V-489**

KZRV, L.P. is recalling certain model year 2006-2013 towable travel trailers manufactured January 1, 2006, through April 25, 2013 and equipped with Fastec-Brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. KZRV, L.P. will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall is expected to begin by the end of December 2013. Owners may contact KZRV L.P. at 1-260-768-4016 or Fastec at 1-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

800-837-2505.

**13V-490**

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2014 Trike motorcycles manufactured July 24, 2013, through September 2, 2013. Due to an incorrectly machined part, the motorcycle may have an excessive steering angle allowing the inner fairing to contact the rear brake fluid reservoir resulting in a loss of brake fluid. Additionally, the steering damper may be damaged. Loss of brake fluid from the rear reservoir would reduce brake performance. Steering damper damage could reduce the rider's ability to control the motorcycle. Either condition increases the risk of a crash. Harley-Davidson will notify owners, and dealers will inspect the trikes and replace the fork stem bracket, as necessary, free of charge. Owners may contact Harley-Davidson at 1-800-258-2464. Harley-Davidson's recall number is 0152.

**13V-491**

Mack Trucks is recalling certain model year 2013-2014 CHU, CXU, GU, LEU, and MRU vehicles manufactured with pro-torque axle spindle nuts from August 28, 2012, through August 16, 2013. The pro-torque nut may not have been installed correctly, which may result in a loosening of the nut. If the nut comes loose, the hub assembly may separate from the vehicle, increasing the risk of a crash. Mack Trucks will notify owners, and dealers will inspect and repair the vehicles, as necessary, free of charge. The recall began on November 12, 2013. Mack's recall number is SC0371. Owners may contact Mack Trucks at 1-336-393-2000.

**13V-492**

Mack Trucks is recalling certain model year 2014 CXU and GU model vehicles manufactured May 10, 2013, through June 12, 2013. The upper and lower steering shaft pinch bolts may have not been torqued to specification. This may cause the steering shaft to come loose. A loose steering shaft would result in a loss of steering control, increasing the risk of a crash. Mack Trucks will notify owners, and dealers will inspect the steering shaft pinch bolts and retorque them as necessary, free of charge. The recall began on December 11, 2013. Mack's recall number is SC0372. Owners may contact Mack Trucks at 1-336-393-2000.

**13V-493**

Southeast Toyota Distributors, LLC (SET) is recalling certain model year 2012-2013 Tacoma vehicles equipped with 18" Maverick Alloy Wheels. In the affected vehicles, the spare tire requires the use of a different style of lug nut to attach it to the vehicle than the other wheels use. These lug nuts were not provided with the vehicle. If the spare tire/wheel is installed on the vehicle using the lug nuts from another wheel, damage to the wheel could result and may eventually lead to a loose wheel, increasing the risk of a crash. SET will notify owners, and dealers will: (a) Install a Warning Label on the spare tire/wheel, (b) supply a bag containing proper spare wheel lug nuts, and (c) place an Owner's Manual Addendum in the vehicle's glove box. Owners may contact SET at 1-954-429-2000.

**13V-494**

Spartan Motors Chassis Inc. (Spartan Chassis) is recalling certain model year 2011-2013 Transit Bus Chassis Cab buses manufactured February 17, 2011, through February 22, 2013. The park brake cable may be routed

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

in a manner in which it contacts the rear hydraulic brake line. The contact may cause a hole may be worn into the hydraulic brake line which could result in a loss of rear brakes without warning. Loss of rear brakes would result in an increased stopping distance which may cause a crash. Spartan Chassis will notify owners and dealers will properly secure the park brake cable so that it cannot rub against the brake line. This will be done at no cost to the owner. The recall began on November 13, 2013. Owners may contact Spartan Chassis at 1-517-543-6400. Spartan Chassis' recall number is 13020.

**13V-495**

Daimler Trucks North America (DTNA) is recalling certain model year 2014 Freightliner Business Class M2 emergency vehicles manufactured January 29, 2013, through July 12, 2013. The software that shuts down the engine in the event of a vehicle problem may not have been disabled on certain vehicles intended for emergency use. During certain emergency operations, engine shutdown could hamper rescue operations, increasing the risk of injury. DTNA will notify owners and dealers will update the engine software, free of charge. The recall began on December 2, 2013. Owners may contact DTNA at 1-503-745-5219. DTNA's recall number is FL-648, 13R-1.

**13V-496**

Fontaine Modification (Fontaine) is recalling certain model year 2011-2013 Volvo VAH vehicles modified with upward facing exhaust diffusers for use as auto-haulers. In the affected vehicles, heat from the exhaust may transfer to the roof of the truck cab and/or the vehicles above the cab. Excessive heat could result in a fire. Fontaine will notify owners and dealers will replace the diffuser with one of a different shape and design, free of charge. Owners may contact Fontaine at 1-800-366-8246.

**13V-497**

Motor Coach Industries (MCI) is recalling certain model year 2000-2012 D, E, G and J series coaches manufactured January 2000 through June 2011 and equipped with Sure Power battery equalizers containing a particular epoxy sealing, aka 'potting', compound. The specific potting compound used in the subject products for insulation was found to be capable of conducting electricity after being exposed to heat. Once electrically conductive, the material is capable of melting and burning, increasing the risk of a fire. MCI will notify owners, and Sure Power will replace the equalizers, free of charge. Owners may contact MCI at 1-847-285-2000. This campaign is MCI service bulletin 401.

**13V-498**

Neo Manufacturing Inc. LLC (Neo) is recalling certain model year 2010-2011 cargo trailers manufactured February 22, 2010, through May 1, 2011 and equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle, increasing the risk of injury. Neo will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall began on December 4, 2013. Owners may contact Neo at 1-269-503-7630 or Fastec at 1-800-837-2505.

**13V-499**

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

Cheetah Chassis Corporation (Cheetah) is recalling certain model year 2010-2014 20-40 Maximizer trailers manufactured September 14, 2009, through October 3, 2013. In the affected trailers, the weld joining the locator pin's shaft and collar may fail leading to a separation of the locating pin's shaft and collar. As a result, the vehicle's suspension section may become separated during the repositioning procedure and cause injury to those in close proximity to the vehicle. Additionally, the parts may separate from the vehicle and fall onto the roadway while the vehicle is in operation, which could result in serious injury to other motorists or property damage to other vehicles. Cheetah will notify owners and pay for installation of new locating pin assemblies that it will supply, free of charge. The recall began on November 22, 2013. Owners may contact Cheetah Chassis at 1-704-436-2590.

**13V-501**

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2014 Boxster, Boxster S, Cayman, Cayman S and 911 Carrera (S, Cabriolet, S Cabriolet, 4, 4S, 4 Cabriolet, 4s Cabriolet) vehicles manufactured September 2, 2013, through September 23, 2013. In the affected vehicles, the passenger seats may be equipped with defective wiring harnesses resulting in intermittent contact with the harness plug. The intermittent plug may cause the passenger seat frontal and knee airbags may be deactivated. In the event of a crash necessitating airbag deployment, this may increase the risk of injury to the front passenger. Porsche will notify owners, and dealers will replace the front passenger seat free of charge. The recall began on December 11, 2013. Owners may contact Porsche at 1-770-290-3500. Porsche's recall number is AD04.

**13V-502**

Altec is recalling certain model year 2008-2010 WC126/166 and WC126A/166A Wood Chippers with various frame and axle combinations. In certain combinations, the bracket attaching the axle to the chipper may develop cracks and break. If the bracket breaks, the axle may separate from the chipper, increasing the risk of a crash. Altec will notify owners and service personnel will check and replace any axles as necessary, free of charge. The recall began on November 15, 2013. Owner's may contact Altec at 1-877-462-5832. Altec's recall number is CSN 581.

**13V-503**

A-Z Bus Sales, Inc. (A-Z Bus) is recalling certain model year 2005-2013 Blue Bird A3RE and D3RE school buses equipped with C.E. White-brand flip seats. When a Flip Seat is installed in front of another passenger seat, it is possible for the occupant of the rearward passenger seat to insert their toes and/or foot into the lower frame area of the Flip Seat. When a vehicle passenger occupies the Flip Seat, pushing the seat bottom downward to the horizontal position to sit in the seat, the occupant of the rearward seat could suffer a pinch point injury to their toes and/or foot. A-Z Bus Sales will notify the school bus owners of the safety recall. A-Z Bus Sales will install a safety guard to cover the gap in the lower frame of the flip seat. A notification schedule for this campaign has not yet been established. Owners can contact A-Z Bus at 1-800-437-5522 or C. E. White at 1-419-492-2157 for more information.

**13V-504**

Toyota Motor Engineering & manufacturing North America, Inc. (Toyota) is recalling certain model year 2013-2014 Camry and Camry HV, model year 2013 Avalon and Avalon HV and model year 2014 Corolla vehicles.



## **SAFETY DEFECT/NONCOMPLIANCE NOTICES**

**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

In the affected vehicles, the windshield wiper switch assembly may short circuit. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard, No. 104, "Windshield Wiping and Washing Systems." A short circuit could cause inoperative windshield wipers, reducing driver visibility and increasing the risk of a crash. Toyota will notify owners, and dealers will replace the wiper switch assembly, free of charge. The recall began on November 8, 2013. Owners may contact Toyota at 1-800-331-4331.

**13V-505**

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2013-2014 Cayenne and Cayenne GTS, model year 2013 Cayenne Diesel and model year 2014 Cayenne S, S Hybrid, Turbo, and Turbo S vehicles manufactured May 27, 2013, through July 10, 2013. In the affected vehicles, the calculated range of the remaining fuel displayed on the instrument cluster may be higher than the actual range. Additionally, the fuel level indicated by the fuel gauge may also be higher than actual amount in the tank. The fuel display inaccuracies may result in the vehicle expectedly running out of fuel and stalling, increasing the risk of a crash. Porsche will notify owners, and dealers will update the instrument cluster software free of charge. The recall is expected to begin in late November 2013. Owners may contact Porsche at 1-800-767-7243. Porsche's recall number is AD03.

**13V-506**

Irbit Motorworks of America, Inc. (Irbit) is recalling certain model year 2012 Ural Gear-up, Patrol, Patrol T, Tourist, and Tourist T motorcycles with sidecars produced June 2, 2012, through October 25, 2012. The aluminum rims manufactured in April 2012 were improperly heat treated which could result in cracked, split or broken rims. The failure of a rim may result in a wheel lock up, increasing the risk of a crash. Irbit will notify owners, and dealers will inspect the motorcycles and replace any aluminum rims manufactured in April 2012, free of charge. The recall began during November 2013. Owners may contact Irbit Motorworks at 1-425-702-8484.

**13V-507**

Big Tex Trailer Manufacturing (Big Tex) is recalling certain model year 2013-2014 10PI, 12PI, 14PI, 29SA, 30AA, 30LS, 30SA, 30SV, 35AA, 35LS, 35SA, 35SV, 45LA, 45SS, 50LA, 50SA, 60SP, 70LR, 70PI, 70SP, and 70TV utility trailers manufactured March 2013, through September 30, 2013. The affected trailers are equipped with a fold flat ramp gate system. Vibrations from towing the trailer may cause the ramp gate latches to fail. Should both ramp gate latches fail while the trailer is in tow, the ramp gate will fall from the upright, stowed position into the down position, and be dragged behind the trailer. This could result in an increased risk of a crash. Big Tex will notify owners, and dealers will install a supplemental gate latch, free of charge. The recall is expected to begin in mid-December 2013. Owners may contact Big Tex at 1-800-594-5637.

**13V-508**

Outdoors RV Manufacturing (Outdoors RV) is recalling certain model year 2010-2014 Wind River, Timber Ridge and Back Country, model year 2010-2012 Tamarack Trails, model year 2012-2014 Black Stone and model year 2014 Black Rock travel trailers equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Outdoors RV will notify owners,

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall began on December 4, 2013. Owners may contact Outdoors RV at 1-724-423-7440 or Fastec at 1-800-837-2505.

**13V-509**

Northwood Manufacturing, Inc. (Northwood) is recalling certain model year 2007-2014 Arctic Fox, Nash, and Desert Fox, model year 2011-2012 Fox Creek and model year 2011-2014 Fox Mountain, Snow River and Wolf Creek trailers, fifth wheels, toy haulers and pickup campers equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Northwood will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall began on December 4, 2013. Owners may contact Northwood Manufacturing at 1-541-962-6274 or Fastec at 1-800-837-2505.

**13V-510**

Gulft Stream Coach (Gulf Stream) is recalling certain model year 2007-2013 Cavalier, Innsbrook, Conquest, Amerilite, Stream lite, Emerald Bay, Fire Fly, V Stream Ultra, Mako, Gulf Breeze, Side Track, Matrix, Mini Superlite, Zero Gravity, Visa, Capri, Northern Express, Vista, Aztec, Yellowstone, Prairie Schooner, G Force, Max Wide Open, Endura Max, Canyon Trail, Sedona, Ridgeline, Kingsport, Trail Master, Sky and Bull Dog travel trailers manufactured January 1, 2006, through April 25, 2013 and equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Gulf Stream will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Fastec at 1-800-837-2505 or Gulf Stream at 1-574-773-7761. Gulf Stream's recall number is 13FI-1013.

**13V-511**

Navistar, Inc. is recalling certain model year 2012 Workhorse Custom Chassis W42 and W62 vehicles, manufactured from July 13, 2012, through October 12, 2012, and equipped with hydraulic brakes. In the affected vehicles, the brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash.

Navistar has notified owners, and dealers will replace the FLI switch free of charge. Owners may contact Navistar at 1-800-448-7825. Navistar's recall campaign number is 51302-C.

**13V-512**

Outlaw Conversions (Outlaw) is recalling certain model year 2006-2013 Hart, 4-Star, and Platinum gooseneck horse trailers with living quarters manufactured January 1, 2006, through April 25, 2013 and equipped with

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. Outlaw will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall is expected to begin by the end of December 2013. Owners may contact Outlaw at 1-254-968-5733 or Fastec at 1-800-837-2505.

**13V-513**

Jayco is recalling certain model year 2014 Jay Flight and Jay Flight Swift Travel Trailers manufactured July 8, 2013, through August 30, 2013. In the affected vehicles, an improper amount of insulation may be stripped from the 110V AC water heater ignition wires resulting in a poor connection of the wires. A poor wiring connection could increase the wiring's resistance, causing excessive heat, resulting in an increased risk of fire. Jayco will notify owners, and dealers will inspect the installation of the LP/Electric water heater and repair it as necessary, free of charge. The recall began on December 12, 2013. Owners may contact Jayco at 1-800-283-8267.

**13V-514**

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2014 FLHTCU, FLHTK, FLHTP, FLHX, FLHXS, FLHTKSE, and FLHRSE motorcycles manufactured May 3, 2013, through October 14, 2013. The clutch master cylinder may allow air into the clutch system. Additionally, the motorcycles may have been assembled with an incorrect clutch release plate. Either condition may prevent the clutch from disengaging. If the clutch does not disengage, the rider may have difficulty slowing or stopping the motorcycle, increasing the risk of a crash. Harley-Davidson has already notified owners, and dealers will rebuild the clutch master cylinder and install the proper clutch release plate, as necessary, free of charge. The recall began in late October 2013. Harley-Davidson's recall number is 0153. Owners may contact Harley-Davidson at 1-800-258-2464.

**13V-515**

Entegra Coach is recalling certain model year 2010-2014 Anthem and Cornerstone motorhomes manufactured December 16, 2009, through April 30, 2013. The power cables from the exterior freezer can be damaged due to contact with the freezer sliding tray rails. Prolonged rubbing of the power cables against the sliding tray rails may cause the wires to short circuit, increasing the risk of a fire. Entegra Coach will notify owners, and dealers will secure the freezer power cables to prevent their chafing, at no charge. The recall began on December 10, 2013. Owners may contact Entegra Coach at 1-800-945-4787.

**13V-516**

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain model year 2014 FLHTCUTG, FXSBE, and FLSTNSE motorcycles manufactured May 3, 2013, through October 14, 2013. The affected motorcycles may have been built with an incorrect clutch release plate. An incorrect clutch release plate may prevent the clutch from disengaging. If the clutch does not disengage, the rider may have difficulty slowing or stopping the motorcycle, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will inspect the clutch release plate. If the clutch is incorrect, it will be replaced free of charge. The recall began in October 2013. Harley-Davidson's recall number is 0154. Owners may contact Harley-Davidson at 1-800-

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

258-2464.

**13V-517**

Pierce Manufacturing Inc. (Pierce) is recalling one model year 2009 Enforcer emergency vehicle and certain model year 2009-2013 Arrow XT, Saber, Velocity, Impel, Quantum, and Commercial vehicles. The trailer connector circuit was wired such that the stop signal overrides the turn signal and the trailer lights do not indicate a turn when brakes are applied. The trailer connector circuit was wired such that the stop signal overrides the turn signal and the trailer lights do not indicate a turn when brakes are applied. This may confuse other drivers, increasing the risk of a crash. Pierce will notify owners, and dealers will install a new electrical harness, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Pierce at 1-920-832-3000. Pierce's recall number is 74B244.

**13V-518**

Glaval Bus is recalling certain model year 2009-2010 transit buses, models: Entourage, Sport, Universal, Titan, Titan II, Apollo, Primetime, Concorde, and Concorde II; and manufactured August 4, 2009, through June 7, 2010. Voltage spikes may damage electrical components and electrical circuits. High resistance may cause the PC board to overheat, increasing the risk of a fire. Glaval Bus will notify owners and direct them to contact A&M. A&M will replace the PC board, free of charge. Owners may contact Glaval Bus at 1-574-262-2212.

**13V-520**

Nissan North America Inc. (Nissan) is recalling certain model year 2013 NV200 vehicles manufactured February 6, 2013, through August 2, 2013. Due to the routing of the wiring harness that connects the fusible link to the battery fuse terminal, the wiring harness may wear through its protective covering, allowing the wires to touch the bracket that holds the fusible link. If the wires and the bracket make contact, a short circuit may result, causing the battery terminal fuse to blow. If the fuse blows while driving, the fuel pump will stop and cause the engine to stop running, increasing the risk of a crash. Nissan will notify owners, and dealers will inspect and reposition the wiring harness and apply a protective covering to it, free of charge. The recall is expected to begin in mid-December 2013. Owners may contact Nissan Customer Service at 1-800-647-7261.

**13V-521**

RC Trailers Inc. is recalling certain model year 2006-2013 RC and MTI enclosed trailers manufactured January 1, 2006, through April 25, 2013 and equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the trailer at the time will then be locked in and be unable to exit the vehicle, increasing the risk of injury. RC Trailers will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall is expected to by the end of December 2013. Owners may contact RC Trailers at 1-574-825-9518 or Fastec at 1-800-837-2505.

**13V-522**

Ford is recalling certain model year 2012-2014 Focus Electric vehicles manufactured September 15, 2011, through August 23, 2013. In the affected vehicles, there may be sudden loss of motive power. A loss of motive

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

power while driving increases the risk of a crash. Ford will notify owners, and dealers will reprogram the power control module, free of charge. The recall began on November 22, 2013. Ford's recall campaign number is 13S09. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332.

**13V-523**

Turtle Top is recalling certain model year 2009 Odyssey LT transit buses built on Ford Chassis manufactured August 1, 2009, through October 13, 2009 and equipped with A & M Systems passenger entrance/exit doors. Voltage spikes may damage the electrical components and electrical circuits of the door actuator, causing the circuit board to develop high resistance. High resistance may cause the board to overheat, increasing the risk of a fire. Turtle Top will notify owners and A&M Systems will replace the affected circuit boards, free of charge. The recall began on December 9, 2013. Owners may contact Turtle Top at 1-800-296-2105 or A&M at 1-574-522-5000 extension 15.

**13V-524**

Pierce Manufacturing Inc. (Pierce) is recalling certain model year 2000-2009 Enforcer and model year 2000-2010 Dash, Lance, and Arrow XT vehicles. While raising or lowering the cab as part of vehicle maintenance, the mounts on which the cab tilt cylinders pivot may fatigue and fail allowing the cab to fall until the safety catch activates. If a person is in the path of the moving cab when a mount fails, the person may be hit by the falling cab, increasing the risk of injury. Pierce will notify owners, and dealers will affix new safety signs advising the operator to stay clear of the cab while it is being tilted, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Pierce at 1-920-832-3000. Pierce's recall number is 74B240.

**13V-525**

BMW is recalling certain model year 2012 K1600 G and K1600 GTL motorcycles. In certain riding conditions, an implausible signal may be registered within the engine control unit, limiting the engine speed. The engine could stall, increasing the risk of a crash. BMW will notify owners, and dealers will update the throttle control software, free of charge. The safety recall is expected to begin in December 2013. Owners may contact BMW customer relations at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

**13V-526**

Setra of North America (Setra) is recalling certain model year 2012 S407 CC, 2007-2010 S417, and 2011-2013 S417 TC coaches equipped with Sure Power battery equalizers or DC-DC converters containing a particular epoxy sealing, aka 'potting', compound. The specific potting compound used in the subject products for insulation was found to be capable of conducting electricity after being exposed to heat. Once electrically conductive, the material is capable of melting and burning, increasing the risk of a fire. Motor Coach Industries (MCI), Setra's importer and designated agent for sales, service and warranty, will notify owners, and Sure Power will replace the equalizers or converters, free of charge. The recall is expected to begin in December 2013. Owners may contact MCI at 1-866-624-2622 or Setra Customer Service Line at 1-800-241-2947. Setra's recall number is 54.10U09052A.

**13V-530**

Spartan Motors Inc. (Spartan) is recalling certain model year 2013-2014 K2, K3, MetroStar, and MM motor

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES**

**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

homes and one emergency response chassis. Castle nuts for the steering linkage ball joint fasteners, which mount to bell cranks, may be loose. If the castle nuts become completely loose, the steering linkage may separate from the bell cranks without warning. This may cause a loss of steering, increasing the risk of a crash. Spartan will notify owners, and dealers will inspect the castle nuts and tighten them as necessary. The recall began on December 9, 2013. Owners may contact Spartan at 1-517-543-6400. Spartan's recall campaign number is 13025.

**13V-531**

Prevost is recalling certain model year 2009-2010 H3-45 and model year 2009 H3-41, X3-45, XLII Converted Coach Shells and XLII-45 Entertainer Converted coach and model year 2008 H3-VIP coach shells. The mechanical springs used to return the accelerator pedal to idle after the driver lifts their foot off the pedal may break. If the springs break, the pedal may not return to idle once the driver lifts their foot off the pedal. This unintended acceleration increases the risk of a crash. Prevost will notify owners, and dealers will replace the affected accelerator pedals, free of charge. The recall began on December 17, 2013. Owners may contact Prevost at 1-418-883-2888. Prevost's recall number is SR13-72.

**13V-532**

Trailex is recalling certain model year 2006-2013 CTE-80180, model year 2007-2013 CTE-80210 HD and model year 2013 CTE-84180 enclosed car trailers equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the car trailer at the time will then be locked in and be unable to exit the vehicle, increasing the risk of injury. Trailex will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall is expected to begin by the end of December 2013. Owners may contact Trailex at 1-330-533-6814 or Fastec at 1-800-837-2505.

**13V-533**

Prevost is recalling certain model year 2008-2009 X3-45 and X3-45 Entertainer coach buses manufactured November 2, 2006, through November 27, 2008. In the affected buses there are two battery cables. One of cables may have been inadvertently installed in a p-clamp. As a result, the cable that is not run through the p-clamp may rub against the p-clamp causing a short circuit. A short may result in a vehicle fire. Prevost will notify owners, and dealers will remove the p-clamp, inspect, and replace the affected battery cable as necessary, free of charge. The recall began on December 16, 2013. Owners may contact Prevost at 1-418-883-2888. Prevost's recall number is SR13-73.

**13V-534**

Ford Motor Company (Ford) is recalling certain model year 2011-2012 F-350/450/550 Ambulance Package vehicles manufactured February 22, 2010, through October 19, 2012 and equipped with a 6.7L diesel engine. Due to an exhaust sensor problem, the vehicles may experience loss of power followed by an engine stall. An unexpected engine stall increases the risk of a crash. Additionally, if this were to occur when the ambulance is transporting a patient, there is an increased risk of injury to the patient. Ford will notify owners, and dealers will replace the exhaust gas temperature sensor, free of charge. The recall began on November 25, 2013. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332. Ford's recall campaign

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

number is 13S10.

**13V-535**

Daimler Trucks North America (DTNA) is recalling certain model year 2013 Thomas Built Minotour SRW school buses manufactured June 19, 2013, through August 9, 2013. Incorrect components may have been used to install the 5th row seat barrier. In the event of a crash, the incorrect installation may cause the barrier to not perform as designed, increasing the risk of injury. DTNA has notified owners, and dealers will correct the barrier's installation, free of charge. The recall began on December 5, 2013. Owners may contact DTNA at 1-503-745-5219. DTNA's recall number is FL-649.

**13V-536**

Daimler Trucks North America (DTNA) is recalling certain model year 2012-2014 Thomas Built Saf-T-Liner HDX and Saf-T-Liner EFX school buses manufactured October 17, 2011, through July 2, 2013. A U-bolt intended to reinforce certain seats installations to the chassis may have been left out of the assembly process. In the event of a crash, the seats may not stay mounted to the chassis, increasing the risk of injury. DTNA will notify owners and dealers will install the U-bolts as required, free of charge. The recall began on December 13, 2013. Owners may contact DTNA at 1-503-745-5219. DTNA's recall number is FL-650.

**13V-537**

Daimler Trucks North America (DTNA) is recalling certain model year 2013 Freightliner Cascadia vehicles with rear axles assembled by Meritor and equipped with ConMet Preset Plus Hubs manufactured from August 6, 2012 through December 7, 2012. In the affected axles, the axle hub may be missing a locking snap ring. If the snap ring is missing, the rear wheels may separate from the vehicle, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect the affected wheel ends for the lock ring, and install them as necessary, free of charge. The safety recall is expected to begin by the end of December 2013. Owners may contact DTNA at 1-503-745-6910. The manufacturer's recall number is FL-653.

**13V-538**

Daimler Trucks North America (DTNA) is recalling certain model year 2014 Saf-T-Liner C2 school buses manufactured July 9, 2013, through September 12, 2013. The rivets used to attach the seat track to the floor may not have been properly seated when installed. In the event of a crash, seat track rivets not properly seated may increase the risk of injury. DTNA will notify owners and dealers will reinforce the seat track mounting as required, free of charge. The recall is expected to begin in December 2013. Owners may contact DTNA at 1-503-745-5219. DTNA's recall number is FL-651.

**13V-539**

Forest River is recalling certain model year 2008-2011 Flagstaff, Rockwood, Cherokee, Salem, and Surveyor recreational vehicles. These vehicles contain incorrect tire inflation pressures and wheel rim sizes on the Vehicle Certification Label. Thus, these vehicles fail to comply with the requirements of the Code of Federal Regulations, Part 567, "Certification." The incorrect tire pressure information given on the Federal Certification Tag and Tire Information Tag may lead to the tire being overinflated, resulting in sudden tire failure, increasing the risk of a crash. Forest River will notify owners and will provide a replacement label, free of charge. The recall is

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES**

**RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

expected to begin in December 2013. Owners may contact Forest River at 1-574-825-7178.

**13V-540**

McLaren Automotive, Inc. (McLaren) is recalling certain model year 2012-2014 MP4 12-C Spider and Coupe vehicles manufactured October 10, 2011, through October 23, 2013 and originally sold in, or currently registered in, Florida, Georgia, Alabama, Mississippi, Louisiana, and Texas. Due to a combination of high ambient temperatures and humidity, the wiper motor brushes may jam causing the wiper motor to stop working. Non-functioning wipers during inclement weather may reduce the driver's visibility, increasing the risk of a crash. McLaren will notify owners and dealers will replace the wiper motors, free of charge. Vehicles outside of the recall area will have a lifetime warranty on their wiper motors that fail for this issue. The recall is expected to begin in early December 2013. Owners may contact McLaren at 1-646-429-8916.

**13V-541**

Blue Bird Corporation (Blue Bird) is recalling certain model year 2014 All American and Conventional school buses manufactured July 2, 2013, through October 3, 2013 and equipped with front suspension bolts marked with a "ZY" code on the bolt head. Due to a problem in the bolt manufacturing process, the bolts that hold the front suspension may break. A broken suspension bolt would require greater steering input to control the bus, thereby increasing the risk of a crash. Blue Bird will notify owners, and dealers will inspect the front suspension bolts. Any bolts with a "ZY" code will be replaced free of charge. The recall began on December 10, 2013. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's number for this recall is R13WR.

**13V-543**

Blue Bird Corporation (Blue Bird) is recalling certain model year 2014 All American and Conventional Vision non-school buses manufactured July 2, 2013, through October 3, 2013 and equipped with front suspension bolts marked with a "ZY" code on the bolt head. Due to a problem in the bolt manufacturing process, the bolts that hold the front suspension may break. A broken suspension bolt would require greater steering input to control the bus, thereby increasing the risk of a crash. Blue Bird will notify owners, and dealers will inspect the front suspension bolts. Any bolts with a "ZY" code will be replaced free of charge. The recall began on December 10, 2013. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's number for this recall is R13WR.

**13V-545**

Isuzu Manufacturing Services of America, Inc (Isuzu) is recalling certain model year 2003-2004 Rodeo and Axiom, and 2003 Rodeo Sport vehicles that were originally sold in, or are currently registered in, Maine, New Hampshire, Vermont, Massachusetts, Rhode Island, Connecticut, New York, New Jersey, Pennsylvania, Delaware, Maryland, the District of Columbia, West Virginia, Ohio, Indiana, Michigan, Illinois, Wisconsin, Minnesota, Iowa, Kentucky and Missouri. These vehicles may experience excessive corrosion near the forward mounting point bracket for the left or right rear suspension lower link. The corrosion may allow the bracket to detach from the frame, impacting vehicle handling and increasing the risk of a crash. Isuzu will notify owners, and dealers will inspect the rear suspension lower link bracket area. For vehicles in which little or no corrosion is found, the area will be treated with an anti-corrosive compound. For vehicles in which corrosion has damaged the rear suspension lower link bracket and affected its connection to the vehicle frame, a reinforcement bracket will be installed. In the event the corrosion is so severe that the reinforcement bracket remedy would not be



**SAFETY DEFECT/NONCOMPLIANCE NOTICES  
RECEIVED DURING OCTOBER 2013**

*Published December 19, 2013*

sufficient, Isuzu will offer to repurchase the vehicle for an amount based on the Kelley Blue Book "Private Party" price. All inspections and remedies will be provided free of charge for vehicles that are 10 years old or less. For vehicles older than 10 years, Isuzu will offer a free remedy, but only if the vehicle is presented to an Isuzu service facility dealer within 12 months of when owner notifications were issued, after that time owners will be charged for the repairs. The recall is expected to begin in mid-December 2013. Isuzu owners may contact Isuzu at 1-800-255-6727.

**13V-547**

Exiss/Sooner, HLG is recalling certain model year 2006-2013 Exiss and Sooner travel trailers manufactured January 1, 2006, through April 25, 2013 and equipped with Fastec-brand door locks. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the travel trailer at the time will then be locked in and be unable to exit the vehicle, increasing the risk of injury. Exiss/Sooner will notify owners, and Fastec will coordinate the inspection and replacement of the cylinders, as needed, free of charge. The recall is expected to begin by the end of December 2013. Owners may contact Exiss/Sooner at 1-405-262-6471 or Fastec at 1-800-837-2505.

**13V-563**